

Description



ADD TO BASKET

[Return to Store](#)

Part Number: 34-236-4

Grind Number: XM270H

Lifter Type: Hydraulic Lifter

Ford 429, 460 c.i. 8 CYL. 1968-1994

Engine Family:



Hydraulic-Strong mid-range with good throttle response, great for small blower, noticeable

Description:


Xtreme Marine™ Hydraulic Flat Tappet Camshafts

Cam Family:

Specifications

Specifications			Intake	Exhaust
RPM Range:	1600 to 5800	Valve Lash:	Hyd.	Hyd.
Valve Timing:	0.006	Duration:	270	286
Lobe Separation:	112°	Duration @ .050" Lift:	226	236
Intake Centerline:	110°	Valve Lift:	0.554	0.557
		Lobe Lift:	0.32	0.322

Valve Timing @ 0.006 Lift:

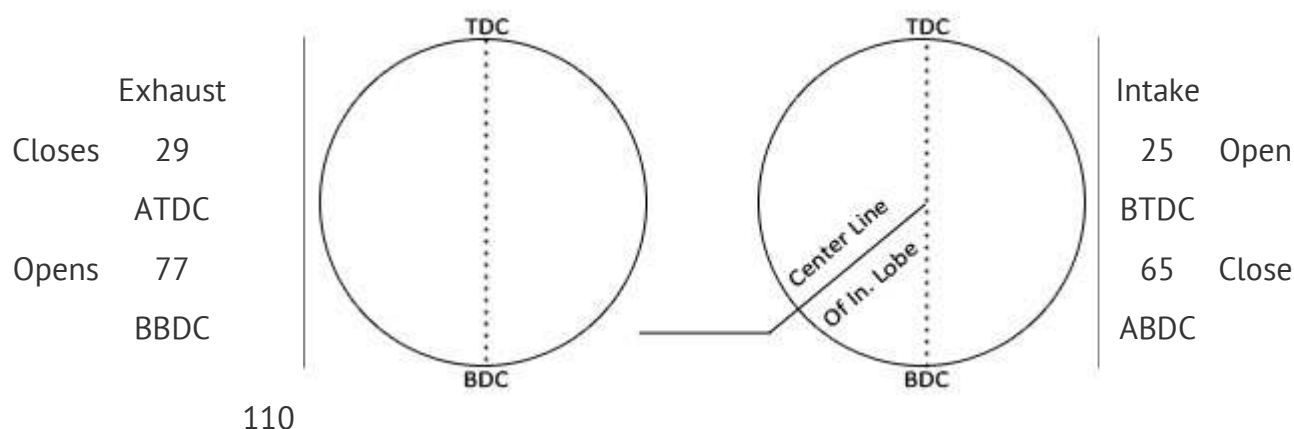

Recommended Components

Component	Part Number
Complete K-Kit	K34-236-4
Small SK-Kit	SK34-236-4 [7]
Cam & Lifter Kit CL-Kit	CL34-236-4 [7]

Lifter Kit	832-16 / 862-16 [37]
Timing Set	2122 / 3122
Rocker Arms	1411-16 [41] / 1330-16 [41]
Push Rods	7651-16 / 7934-16
Valve Springs	924-16 [2] / 930-16 [2]
Steel Retainers	741-16 / 732-16
Valve Locks	611-16
Valve Seals	503-16 [2]
Camshaft Break-In Lube	159

Installation Notes (These notes apply to the above recommended components with the trailing installation note number)

Note	Description
2	[2] Requires machining on cylinder heads.
7	[7] Stock springs cannot be used.
37	[37] Adjustable valve train required.
41	[41] Use screw in studs & guide plates. May require longer pushrods.